



TO: ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES & SERVICE CENTERS  
ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES REPRESENTATIVES

MODEL AFFECTED: XLU1515 WHEN USED WITH MA-329

SYMPTOM: RADIO WILL NOT STEP THROUGH ALL CHANNELS

CURE:

Add C113, 150pF ceramic disc capacitor from the anode of CR101 to ground. Use Regency Part Number 1523-0151-002.

TECHNICAL SERVICE DEPARTMENT  
REGENCY COMMUNICATIONS, INC.



